FIX THESE XENTRY FAULT MESSAGES WHEN DOING SCN ONLINE:

(Code: RDS_400001)

(Code: RDS_0003)

(Code: RDS_225011)

(Code: RDS_0008)

<u>متب</u> > <u>Di.</u>	. > N3/9 - Motor electronics 'CDID3' for combustion engine 'O 🖆 14.7V Ignition ON 🛛 🛃 💓	≡ X	ENTRY Diagnosis wto2845492775721 C (2014) E 271329 284549 T. All	() Mercedes-Benz	
	Tests Symptoms Author data High-voltage on-board electrical system		> A76/1 - Right front reversible emergency tensioning retractor (RevETR-RF)	🖾 13.8V Ignition ON	
合	Version Error codes / Events Actual values Actuations Adaptations Control unit log Special procedures		Version Error codes / Events Actual values Actuations Adaptations Control unit log List of fault codes Tests Author data		
	A fault has occurred!	谕	A fault has occurred!	Operation no.: WDD2043492F775721.2020031616 Date and time: 15.03.2020 - 16.12.49	61140 ^
1	Fault message (Code: 225011)		Fault message (Code: RDS_0008)		
A	The documentation of the control units in the central system is faulty. Please contact the User Help Desk.	e 0	The XENTRY Update Service is not operational.		
	Possible remedy		Possible causes		
	Contacting the User Help Desk		The installation process of the XENTRY Update Service is not yet complete.		
-	Persible entions	-	The XENTRY Update Service is still in the initialization phase.		
-	Select one of the following options.	Siz.	Possible remedies		
	Repeat procedure		Repeat procedure.		
	Continue process		Repeat the procedure later.		
4	Assistance from User Help Desk		Possible options		
			Select one of the following options.		
			O Repeat procedure		
			Continue process		v
	Continue			Contra	ue

Remedies:

I. Configure Configassist and choose Automatic (Xentry 2019-07 to 2019-12) and Without Retail Data Storage (RDS)

			ConfigAssist	Construction			- c × ConfigAssist
Configure XENTRY Update Service	NTRY Update Service active and connected with th	e Baimler backend.		Overview of your system configuration		O O State Service Service less bas for age feet fees less feet fees less feet fees less	
Not the VENTY DARK Service, and appear and service and automatical later (Figs 900 K R) and determine	No Advances of Agriculture interview and the Debits Shift Shared water Note: A Debits Shift Shared water Note: Shift Shift Shared water Note: Shift Shift Shared water Note: Shift S						
Note that it may be a consequent to a PRVID to be a factor - loss province in the Annual As - One to a loss of the annual and the annual to be a sequence of the annual and the annual approximations under not impor- mance).			Startilog Velá Azar 7,4(2013):e7,7(2000				
		<u>í</u>	au Net		(II)	e ^r ©	

- II. Fix "ConfigAssist.exe.config" in C:\Program Files (xxx)\Mercedes-Benz\ConfigAssist
 - 1. Click Ctrl-F and find the word 'online'. Click Find Next until "onlineupdate_pageAvailable". Change the value from "False" to "True"

Find		ializeAs="String">
higo what. Shine	Dimentione	fersize" serializeAs="stri
Match <u>c</u> ase	© <u>Up</u>	d" serializeAs="String">
·····		
Setting name= Ne	Twork Wlan Signal	Strength Normal" serializeAs="String">
<pre><value>40</value>40<!--</td--><td>le></td><td><pre>Strength_Normal" serializeAs="String"></pre></td></pre>	le>	<pre>Strength_Normal" serializeAs="String"></pre>
<pre><setting name="Ne<br"><value>40</value> </setting> <setting name="Ne
<value>80</value></pre></td><td>twork_wlan_signal
twork_wlan_signal</td><td>Strength_Normal" serializeas="String"> Strength_Strong" serializeAs="String"></setting></pre>		
<pre><vetting name="Ne<br"><value>40 <vetting name="Ne
<value>80</value
</setting></pre></td><td>twork_wlan_signal
e>
twork_wlan_signal
e></td><td>Strength_Normal" serializeas="String"> Strength_Strong" serializeAs="String"></vetting></value></vetting></pre>		
<pre><value>40 csetting name="Ne <value>80csetting name="Ne csetting name="Ne</value></value></pre>	twork_wlan_signal twork_wlan_signal e> twork_wlan_signal	Strength_Normal" serializeAs="String"> Strength_Strong" serializeAs="String"> Strength_weak" serializeAs="String">
<pre>Settingsrame="Ne (settings setting name="Ne setting name="Ne setting name="Ne settings" settings" setting name="On setting name="On</pre>	twork_wlan_signal twork_wlan_signal twork_wlan_signal twork_wlan_signal ineupdate_Mode"	<pre>Strength_Normal" serializeAs="String"> Strength_Strong" serializeAs="String"> Strength_weak" serializeAs="String"> serializeAs="String"></pre>
<pre>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>>></pre>	twork_wlan_signal itwork_wlan_signal ie> itwork_wlan_signal i> ilineUpdate_Mode" //value>	Strength_Normal" serializeAs="String"> Strength_Strong" serializeAs="String"> Strength_weak" serializeAs="String"> serializeAs="String">
<pre>/setting name="we /setting cvalue.soc/value setting name="we cvalue.soc/value /setting name="me cvalue.soc/value /setting name="co cvalue.soc/value /setting name="co /setting name="co</pre>	twork_wlan_signal twork_wlan_signal twork_wlan_signal inineUpdate_Mode" /value>	Strength_Normal" serializeAs="String"> Strength_Strong" serializeAs="String"> Strength_weak" serializeAs="String"> serializeAs="String"> ailable" serializeAs="String">

 For XENTRY Windows 32bit only. Click Ctrl-F and find the word 'x86'. Correct the value from 'C:\Program Files (x86)\' to 'C:\Program Files\'. This is more than one. So click "Find Next" to find the others.

Find		ong" serializeAs="String">
Find what: x86		End Next ak" serializeAs="String">
	Direction	Cancel
Match <u>c</u> ase	© <u>U</u> p ● <u>D</u> own	"String">
cvalues Falses (values	
	varue>	
<pre><setting name="0 <value>7001</vi></td><td>nlineUpdate_Publis
alue></td><th>erPort" serializeas="String"></setting></pre>		
<setting name="Oi</td><td>nlineUpdate_Xentry</td><th>pdateServiceLightAssistant_Path" serializeas="String"> cades_Repz_Schfware/YentryuIndateServiceLightAssistant/YentryuIndateServiceLightAssistant_exe/value></setting>		

3. **For XENTRY Windows 32bit only**. Sometimes, an addon, update and install the service(s) with path to 'C:\Program Files (x86)\'. You have to edit and fix the path of that service(s).



In this case, click on Start Menu -> Run and enter "Regedit". Then you need to navigate to HKEY_LOCAL_MACHINE\SYSTEM\CurrentControlSet\Services\[Name of Service]. To change the location of the exe, just change the "ImagePath" key.

b wuauserv	*	Name	Туре	Data
WudfPf WudFRd WudFxc Wudfsvc Warsvc Wwarsvc Wwarsvc Wwarsvc Wwarsvc Wwarsvc Warsvc Warsvc	ervice ifoService ifoServiceLight	(Default) DelayedAutostart Description DisplayName ErrorControl ab ImagePath	REG_SZ REG_DWORD REG_SZ REG_SZ REG_DWORD REG_EXPAND_SZ	(value not set) 0x0000000 (0) The XentryUpdateServiceDeviceInfoService is a Wi Daimler XentryUpdateService DeviceInfoService 0x00000001 (1) C:\Program Files (x86)\Mercedes-Benz Software\X JSystem 0x000002 (2)
XentryUpdateServiceLight XentryUpdateServiceUsP XentryUpdateServiceUsP XentryUpdateServiceWate XentryUpdateServiceWate XentryUpdateServiceWate XentryUpdateServiceWeb XentryUpdat	Value name: ImagePath Value data: [C:\Program Files[\Men	cedes-Benz Software\Xen	tryUpdateServiceDevic	einf

- III. Fix XentryUpdateService (From gcs190) Interesting contribution from fellow @russ34
 - 1. Make sure .NET 4.8 is installed
 - 2. Go to Services on Windows Control Panel, stop and disable 3 Daimler services with DeviceInfo string
 - 3. Download TablePlus software, run and add new connection for PostgreSQL, name: xus, host: 127.0.0.1, port: leave blank, user xfernow, password: xfernow, db: xfernow
 - 4. Choose deviceinfov2 table on left
 - Find "startkeyvalid" column on right, place 'true'. Replace value in "apptype" column from XDOS to KIT2, replace "indiaappid" to 254
 OR you can fill the columns with REAL HWID, APPID from dealer station, which will also fix your system
 - 6. Save changes by pressing "commit" button in the top-left corner
 - 7. Restart PC or restart all XentryUpdate services that are currently running.



IV. From Weryo:

After fixed with TablePlus, when starting service again it resets changed table plus fields. Probably new addons change things again!

Last addons confused the system,...probably they will fix it back!

It is always buggy and complicated,..on one of my laptops everything is working great,..on the other one that updated recently =no flashfiles visible at XUS.

I did just a simple thing: Copied whole XentryUpdateServiceLight folder from my working system from here: C:\ProgramData\Mercedes-Benz\data and paste it onto non working system,...nothing more! ...just need to stop all daimler services first!

Now all working good,..online programing itself download flash files and do programing as it should be!

I mentioned one more bug,...if you use more than one system for online programing at same time,..the programing is very unstable and gives rds errors, that needs to be repeated lots of times till success! This is the real situation with new beta releases,..you know 2019-12 still works good and there are less bugs!